



National Transportation Safety Board Aviation Accident Final Report

Location:	FT. CARSON, CO	Accident Number:	DEN91FA126
Date & Time:	09/11/1991, 0728 MDT	Registration:	N7730Y
Aircraft:	PIPER PA-30	Aircraft Damage:	Destroyed
Defining Event:		Injuries:	1 Fatal
Flight Conducted Under:	Part 91: General Aviation - Personal		

Analysis

THE PILOT WAS FLYING HIS FIRST SOLO PRACTICE FLIGHT THREE DAYS AFTER RECEIVING HIS MULTIENGINE RATING. HE HAD 18 HOURS MULTIENGINE TIME. WHILE BEING VECTORED FOR A PRACTICE APPROACH, THE RIGHT ENGINE QUIT DUE TO FUEL STARVATION. THE AIRCRAFT COULD NOT MAINTAIN ALTITUDE DUE TO SINGLE ENGINE PERFORMANCE LIMITS. THE TURBOCHARGERS WERE NOT ENGAGED. APPROACH CONTROL VECTORED THE AIRCRAFT TO THE NEAREST AIRPORT. THE PILOT HAD DIFFICULTY IN SPOTTING THE AIRPORT AND THE SECOND ENGINE QUIT DUE TO FUEL EXHAUSTION DURING THE APPROACH. THE PILOT THEN INADVERTENTLY STALLED THE AIRCRAFT WHICH ROLLED OVER AND DOVE INTO THE GROUND.

Probable Cause and Findings

The National Transportation Safety Board determines the probable cause(s) of this accident to be: THE LOSS OF POWER TO BOTH ENGINES DUE FIRST TO FUEL STARVATION FOLLOWED BY FUEL EXHAUSTION, THE PILOT'S FAILURE TO REFUEL, AND THE INADVERTENT STALL. A FACTOR WAS: THE PILOT'S IMPROPER USE OF POWERPLANT CONTROLS.

Findings

Occurrence #1: LOSS OF ENGINE POWER(TOTAL) - NONMECHANICAL
Phase of Operation: APPROACH

Findings

1. 1 ENGINE
 2. (C) REFUELING - NOT PERFORMED - PILOT IN COMMAND
 3. (C) FLUID,FUEL - STARVATION
 4. (F) POWERPLANT CONTROLS - IMPROPER USE OF - PILOT IN COMMAND
-

Occurrence #2: LOSS OF ENGINE POWER(TOTAL) - NONMECHANICAL
Phase of Operation: MANEUVERING - TURN TO LANDING AREA (EMERGENCY)

Findings

5. ALL ENGINES
 6. (C) FLUID,FUEL - EXHAUSTION
-

Occurrence #3: FORCED LANDING
Phase of Operation: DESCENT - EMERGENCY

Occurrence #4: LOSS OF CONTROL - IN FLIGHT
Phase of Operation: DESCENT - EMERGENCY

Findings

7. (C) STALL - INADVERTENT - PILOT IN COMMAND
-

Occurrence #5: IN FLIGHT COLLISION WITH TERRAIN/WATER
Phase of Operation: DESCENT - EMERGENCY

Findings

8. TERRAIN CONDITION - MOUNTAINOUS/HILLY

Factual Information

Pilot Information

Certificate:	Private	Age:	35, Male
Airplane Rating(s):	Multi-engine Land; Single-engine Land	Seat Occupied:	Unknown
Other Aircraft Rating(s):	None	Restraint Used:	Seatbelt
Instrument Rating(s):	Airplane	Second Pilot Present:	No
Instructor Rating(s):		Toxicology Performed:	Yes
Medical Certification:	Class 3 Valid Medical--no waivers/lim.	Last FAA Medical Exam:	01/18/1991
Occupational Pilot:	Last Flight Review or Equivalent:		
Flight Time:	1220 hours (Total, all aircraft), 18 hours (Total, this make and model), 1075 hours (Pilot In Command, all aircraft), 30 hours (Last 90 days, all aircraft), 15 hours (Last 30 days, all aircraft)		

Aircraft and Owner/Operator Information

Aircraft Make:	PIPER	Registration:	N7730Y
Model/Series:	PA-30 PA-30	Aircraft Category:	Airplane
Year of Manufacture:		Amateur Built:	No
Airworthiness Certificate:		Serial Number:	30-819
Landing Gear Type:	Retractable - Tricycle	Seats:	4
Date/Type of Last Inspection:	Unknown	Certified Max Gross Wt.:	3725 lbs
Time Since Last Inspection:	0 Hours	Engines:	2 Reciprocating
Airframe Total Time:		Engine Manufacturer:	LYCOMING
ELT:	Installed, activated	Engine Model/Series:	IO-320-CIA
Registered Owner:	RICK L. OWNES	Rated Power:	160 hp
Operator:	RICK L. OWNES	Operating Certificate(s) Held:	None

Meteorological Information and Flight Plan

Conditions at Accident Site:	Visual Conditions	Condition of Light:	Day
Observation Facility, Elevation:	, 0 ft msl	Distance from Accident Site:	0 Nautical Miles
Observation Time:	0000	Direction from Accident Site:	0°
Lowest Cloud Condition:	Scattered / 10000 ft agl	Visibility	10 Miles
Lowest Ceiling:	Broken / 25000 ft agl	Visibility (RVR):	0 ft
Wind Speed/Gusts:	6 knots /	Turbulence Type Forecast/Actual:	/
Wind Direction:	300°	Turbulence Severity Forecast/Actual:	/
Altimeter Setting:	30 inches Hg	Temperature/Dew Point:	13° C / 10° C
Precipitation and Obscuration:			
Departure Point:	COLORADO SPRING, CO (COS)	Type of Flight Plan Filed:	None
Destination:		Type of Clearance:	None
Departure Time:	0616 MDT	Type of Airspace:	

Wreckage and Impact Information

Crew Injuries:	1 Fatal	Aircraft Damage:	Destroyed
Passenger Injuries:	N/A	Aircraft Fire:	None
Ground Injuries:	N/A	Aircraft Explosion:	None
Total Injuries:	1 Fatal	Latitude, Longitude:	

Administrative Information

Investigator In Charge (IIC):	NORMAN F WIEMEYER	Report Date:	05/03/1993
Additional Participating Persons:	RAY RYAN; DENVER, CO		
Publish Date:			
Investigation Docket:	NTSB accident and incident dockets serve as permanent archival information for the NTSB's investigations. Dockets released prior to June 1, 2009 are publicly available from the NTSB's Record Management Division at pubinq@ntsb.gov , or at 800-877-6799. Dockets released after this date are available at http://dms.nts.gov/pubdms/ .		

The National Transportation Safety Board (NTSB), established in 1967, is an independent federal agency mandated by Congress through the Independent Safety Board Act of 1974 to investigate transportation accidents, determine the probable causes of the accidents, issue safety recommendations, study transportation safety issues, and evaluate the safety effectiveness of government agencies involved in transportation. The NTSB makes public its actions and decisions through accident reports, safety studies, special investigation reports, safety recommendations, and statistical reviews.

The Independent Safety Board Act, as codified at 49 U.S.C. Section 1154(b), precludes the admission into evidence or use of any part of an NTSB report related to an incident or accident in a civil action for damages resulting from a matter mentioned in the report. A factual report that may be admissible under 49 U.S.C. § 1154(b) is available [here](#).